

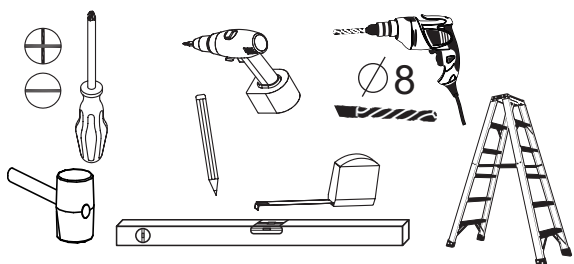
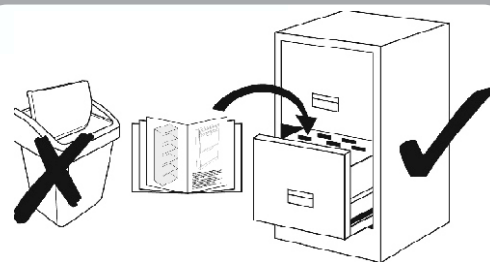
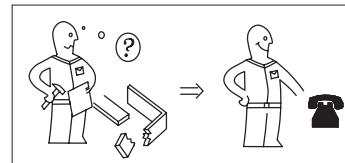
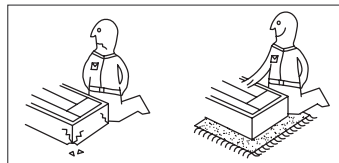
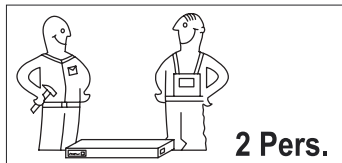


Tia-New

05860025 / 03

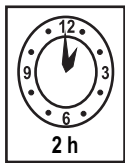

festziehen / tighten / Затягивать /
serrer / stringere / utåhnut / vasttrekken /
zategnuti / strângere / zwiázac / zacisn'æ
szorosan meghúzni / pevne dotiahnut' /
trdno pritegniti / затянуть / dra et

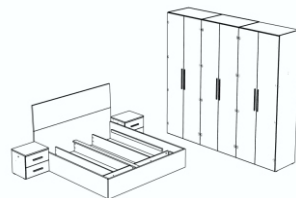

eindrücken / press in / enfoncer / wcisnąć
ribattere / zatlačit / Вкарайте / indrukken
benyomni / stlačit' / vtisniti / tryck in
introducere prin apăsare / вдавить



ausmessen / measure / mesurer /
misurare / opmeten / izmeriti / mîara /
kimérni / izmeriti / măsurare / измерить
změřit / Измерете / mät upp / zmierzyc




drücken / press / presser / stisknout /
Натиснете vtisniti / nasinac / drukken /
pritisnuti / nacinac / pritisniti / нажать /
(meg)nyomni / apăsare / tryck fast / nacinac














einschlagen / hammer in / beverni / sla in
frapper au marteau / infossare / Zabit' /
zarazit / Набийте / zabiti / wbić
introducere prin bătaie / забить / zatlouct






Drehen - wenden / przekrećić - odwrócić /
Keren - omdraaien / Girare - Ruotare /
Okrenuti - ubrnuti / Retourner - renverser /
Turn over - turn around / Otočite - obratite /
Завъртете - обърнете / Obrnite list /
Întoarceți - roțiți / Vrid runt - vänd /
прокрутить - повернуть / otočit - obrátit
elforgatni - megfordítani








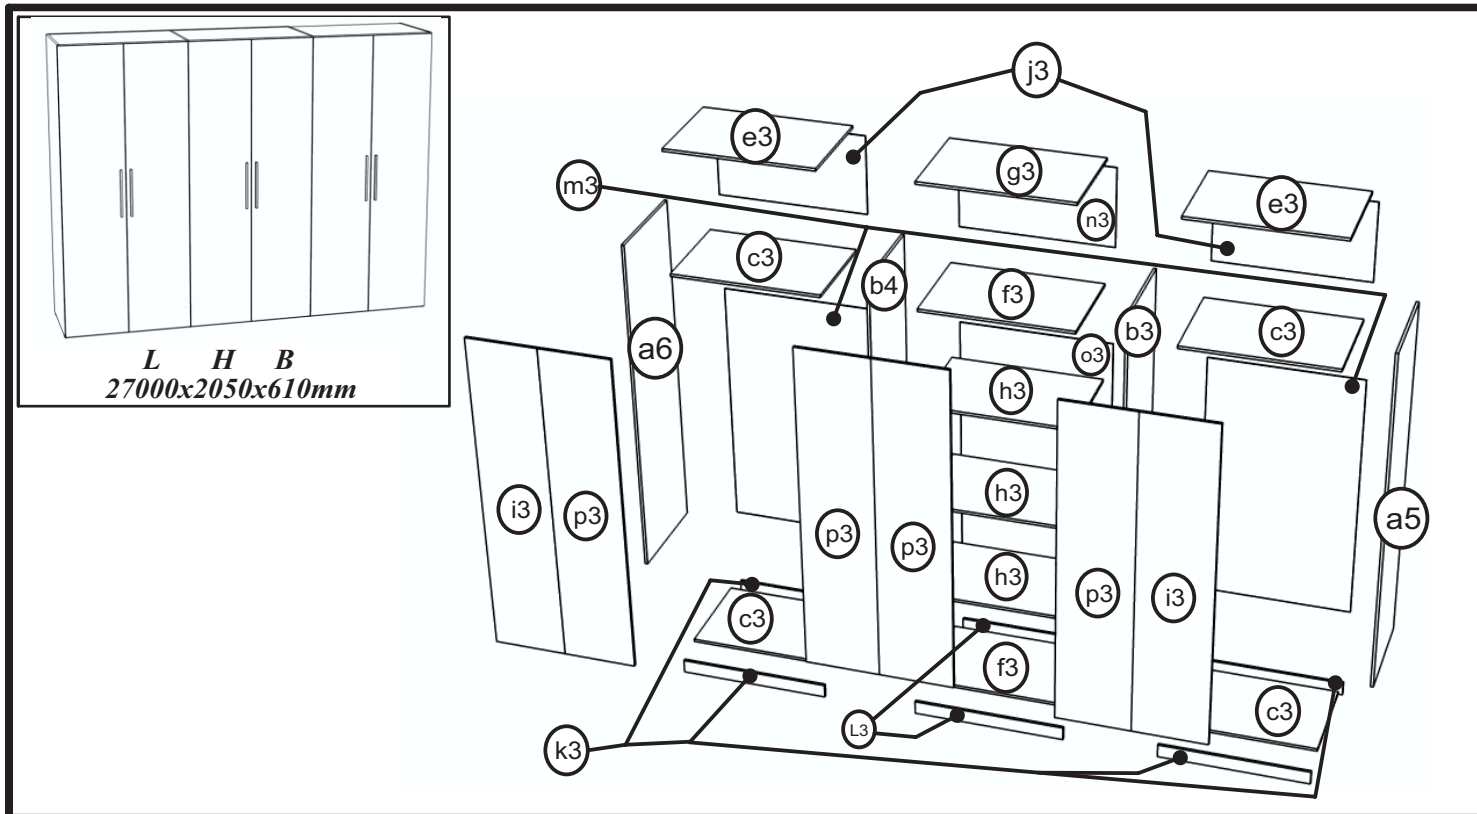














				
1	a5	2048mm x 600mm x 16mm	1	1/15
2	a6	2048mm x 600mm x 16mm	1	1/15
3	b3	2048mm x 580mm x 16mm	1	1/15
4	b4	2048mm x 580mm x 16mm	1	1/15
5	c3	874mm x 580mm x 16mm	4	2/15
6	e3	874mm x 580mm x 16mm	2	2/15
7	f3	885mm x 580mm x 16mm	2	3/15
8	g3	885mm x 580mm x 16mm	1	3/15
9	h3	885mm x 580mm x 16mm	3	2/15
10	i3/ p3	2030mm x 445mm x 18mm	6	2/15
11	k3	784mm x 80mm x 16mm	4	3/15
12	L3	882mm x 80mm x 16mm	2	4/15
13	m3	1464mm x 890mm x 3mm	2	4/15
14	j3	501mm x 890mm x 3mm	2	4/15
15	n3	501mm x 897mm x 3mm	1	4/15
16	o3	1464mm x 897mm x 3mm	1	4/15


1  $\varnothing 15 \times 12 \text{ mm}$ x36	2  $\varnothing 6 \times 45/34 \text{ mm}$ x12	3  $3.5 \times 16 \text{ mm}$ x112	4  $8 \times 35 \text{ mm}$ x60	7  x8
39  $3.5 \times 25 \text{ mm}$ x39	86  320 mm x6	69  $9 \times 20 \times 100 \text{ mm}$ x14	10  $\varnothing 6.3 \times 11 \text{ mm}$ x48	73  $15 \times 15 \times 7 \text{ mm}$ x12
45  $\varnothing 6 \times 1 \text{ mm}$ x4	11  $M4 \times 20 \text{ mm}$ x12	16  $\varnothing 8 \times 50 \text{ mm}$ x3	16  $\varnothing 6 \times 80 \text{ mm}$ x3	43  $90 \times 10 \times 30 \text{ mm}$ x3
25  x8	19  $45 \times 21 \times 7 \text{ mm}$ 4x	Z  x2	8  x16	IMBUS  4 mm x1
49  $\varnothing 7 \times 68 \text{ mm}$ x12	46  $\varnothing 15 \text{ mm}$ x12	58  x39		

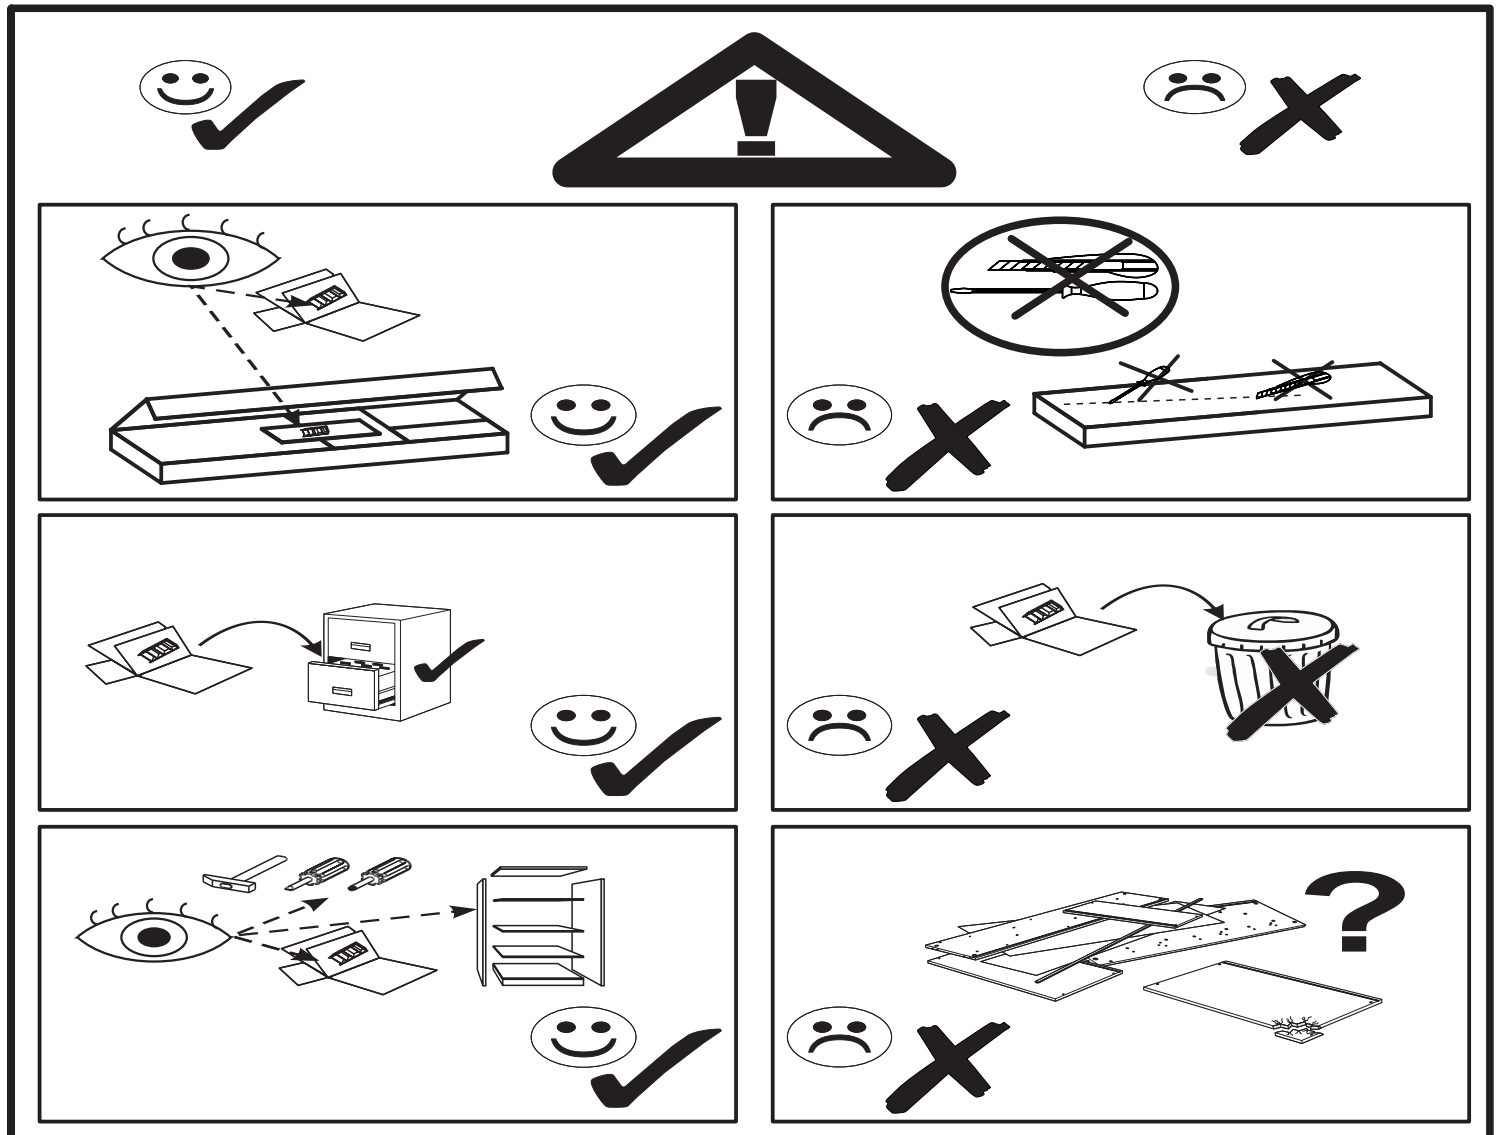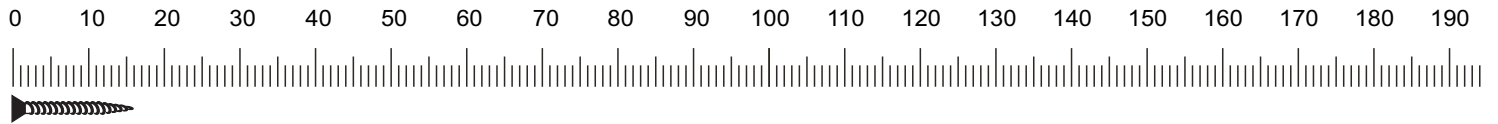





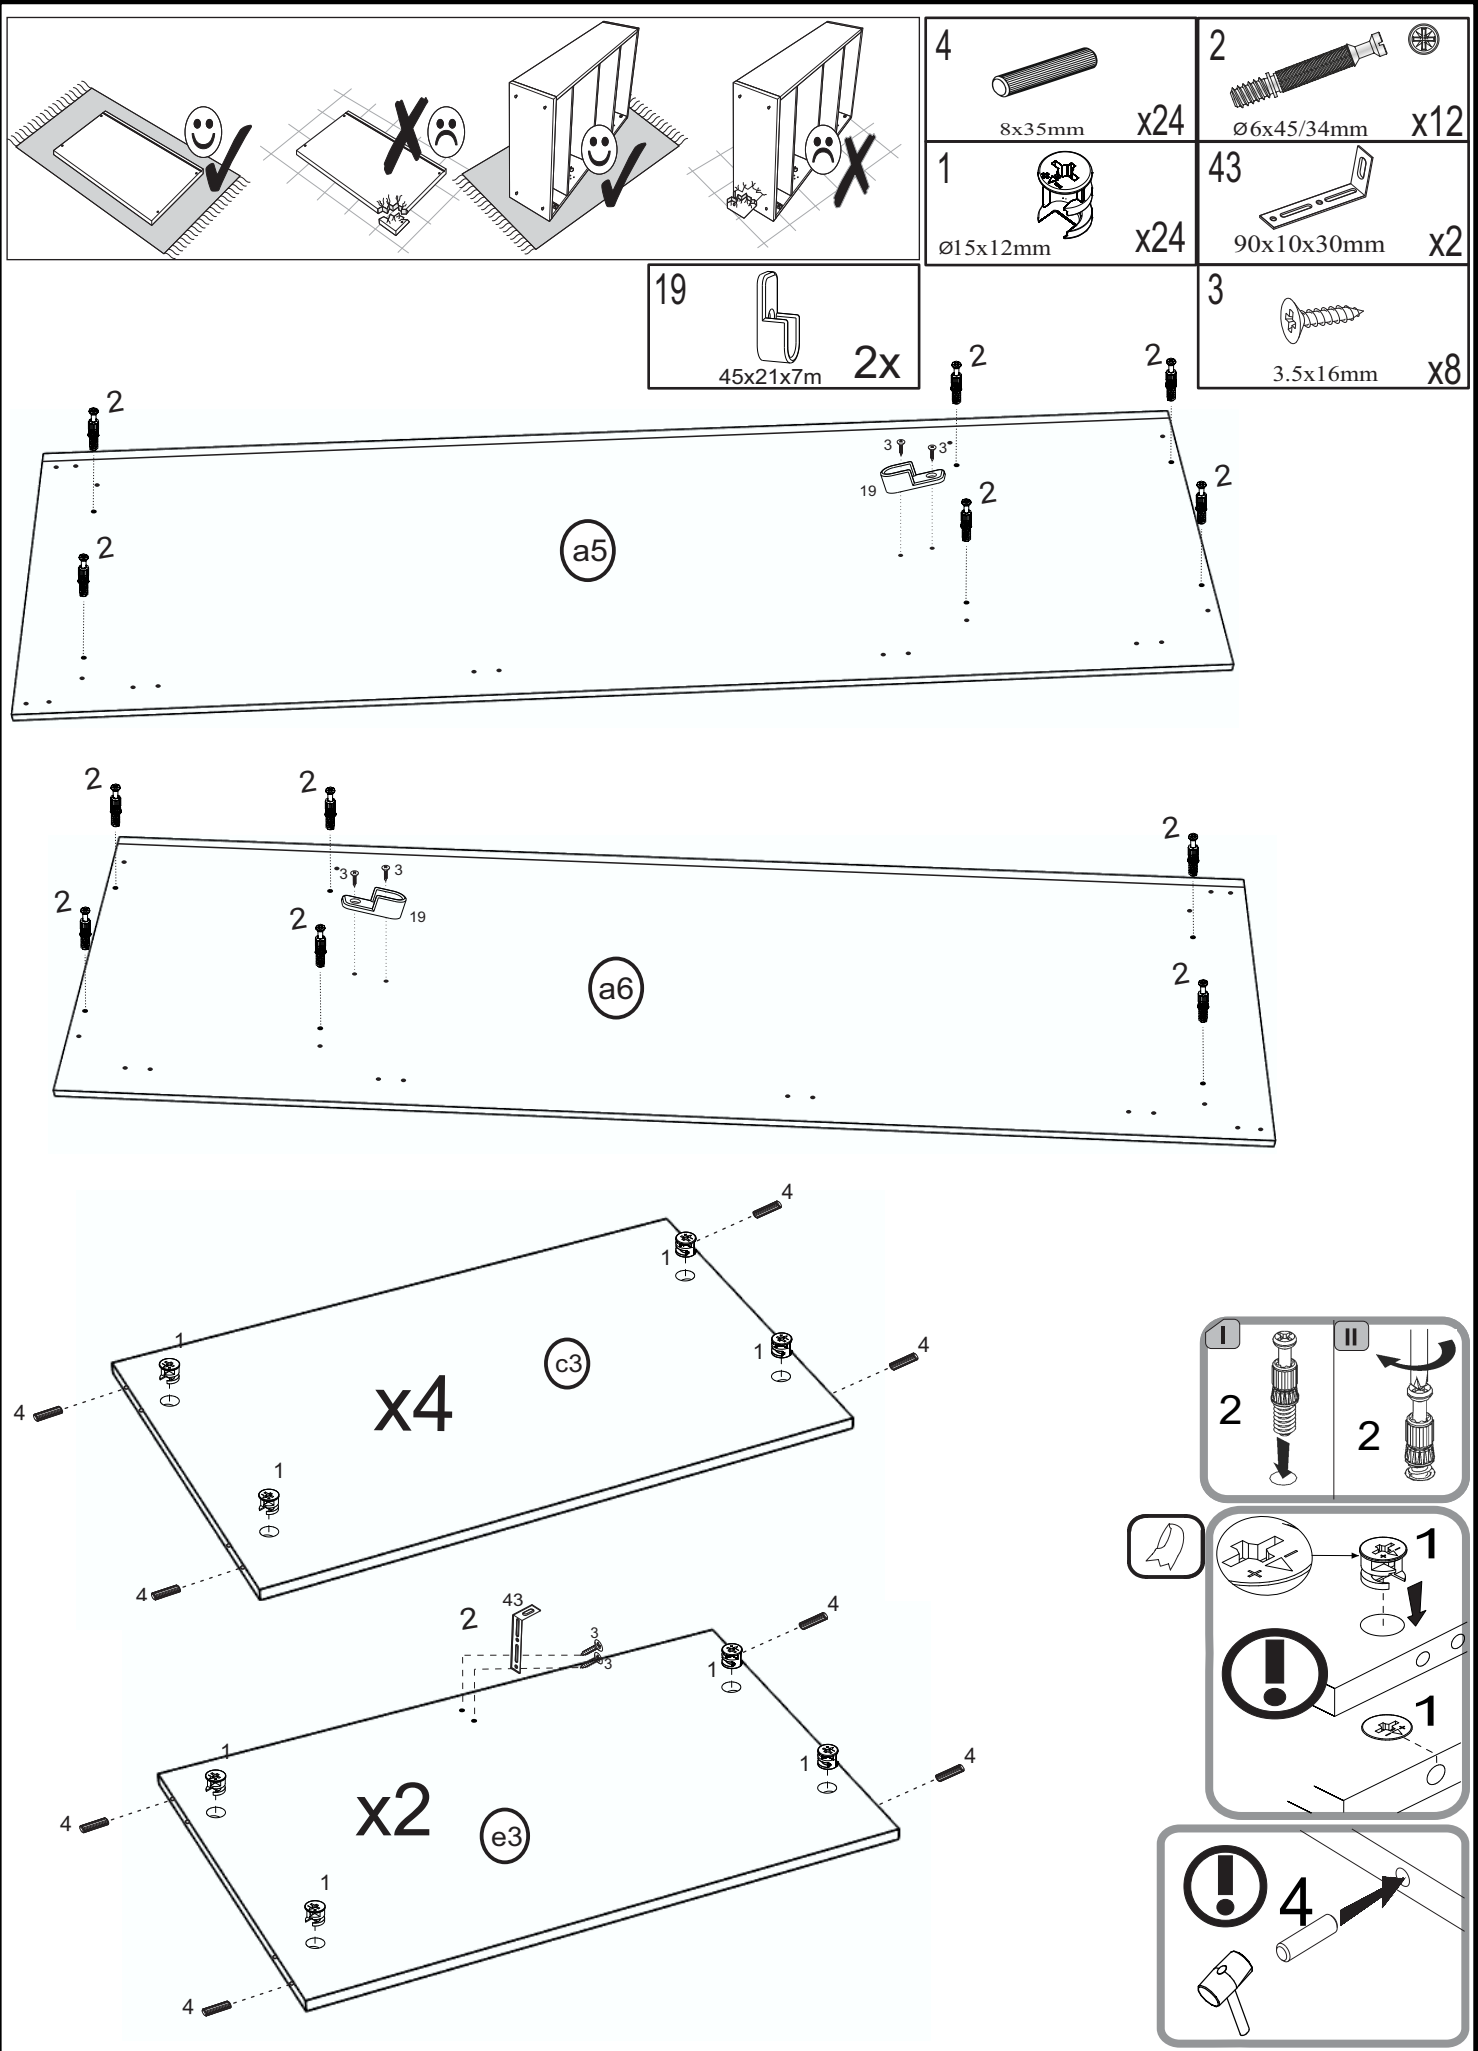


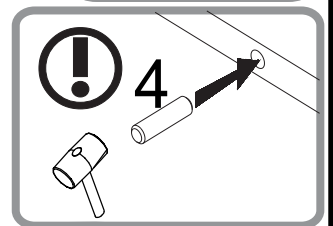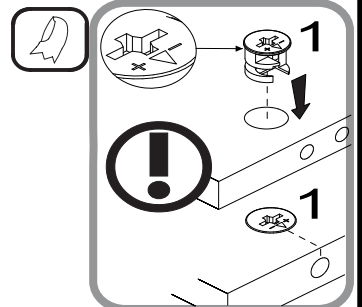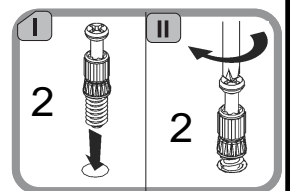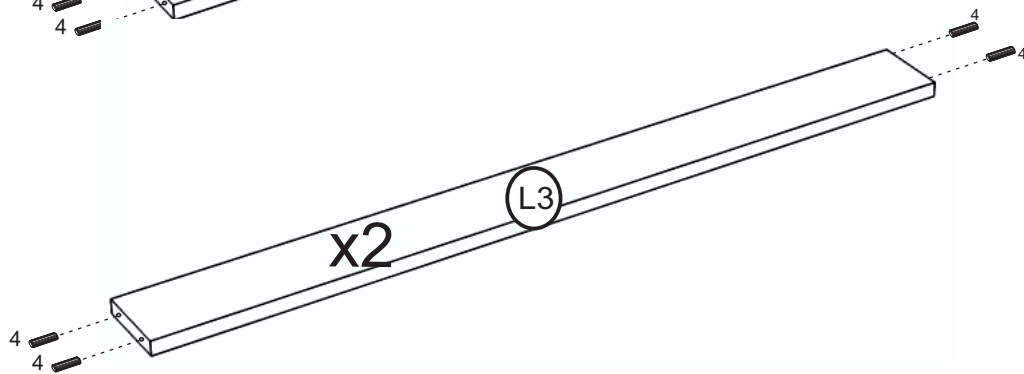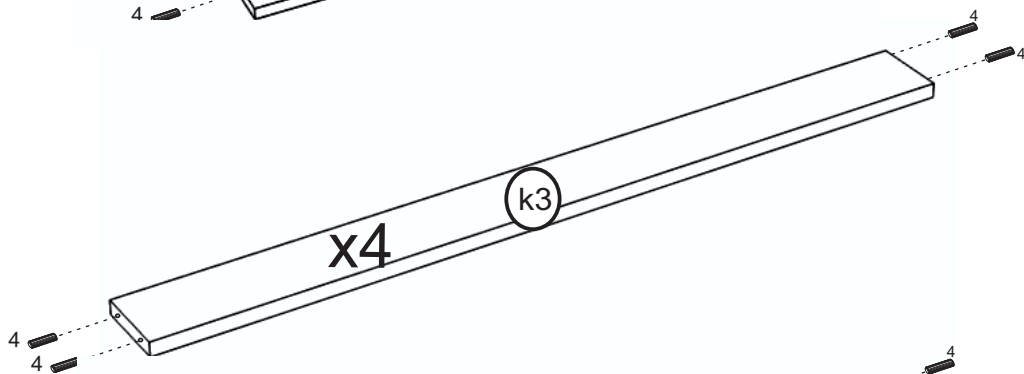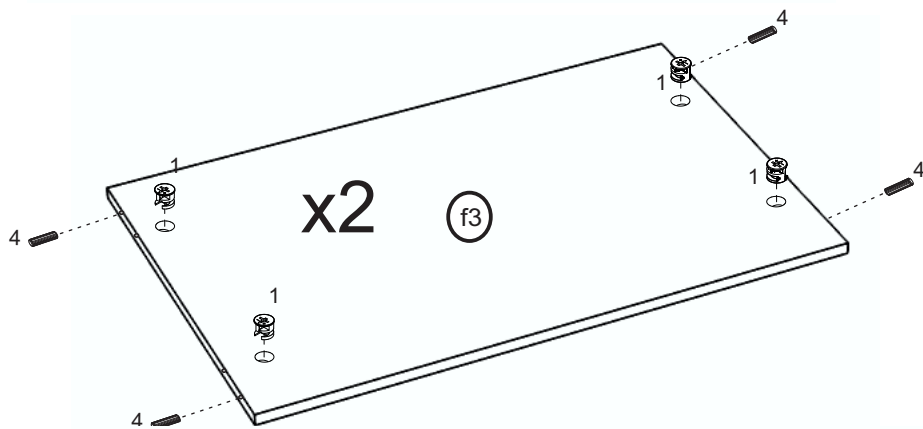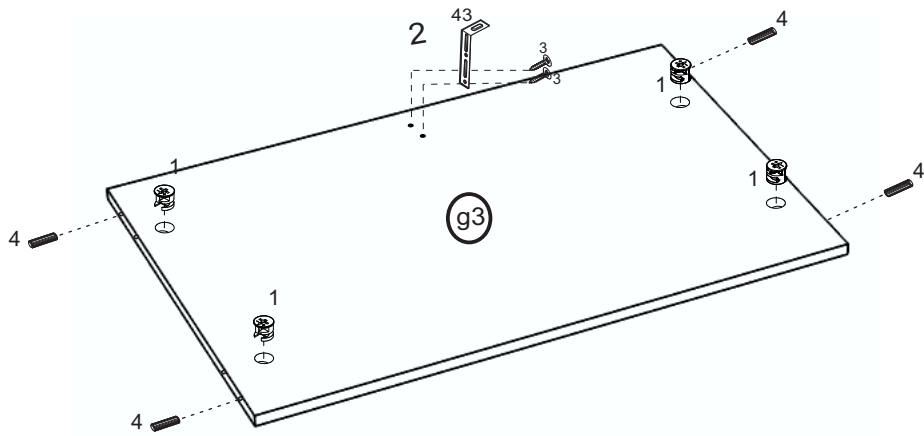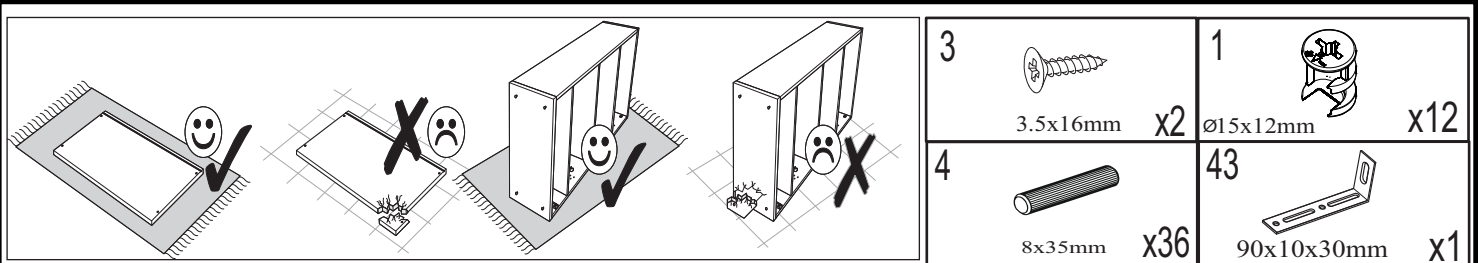


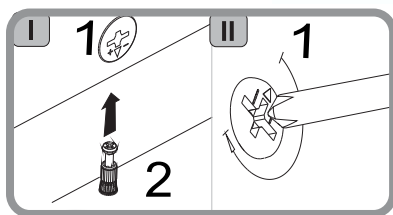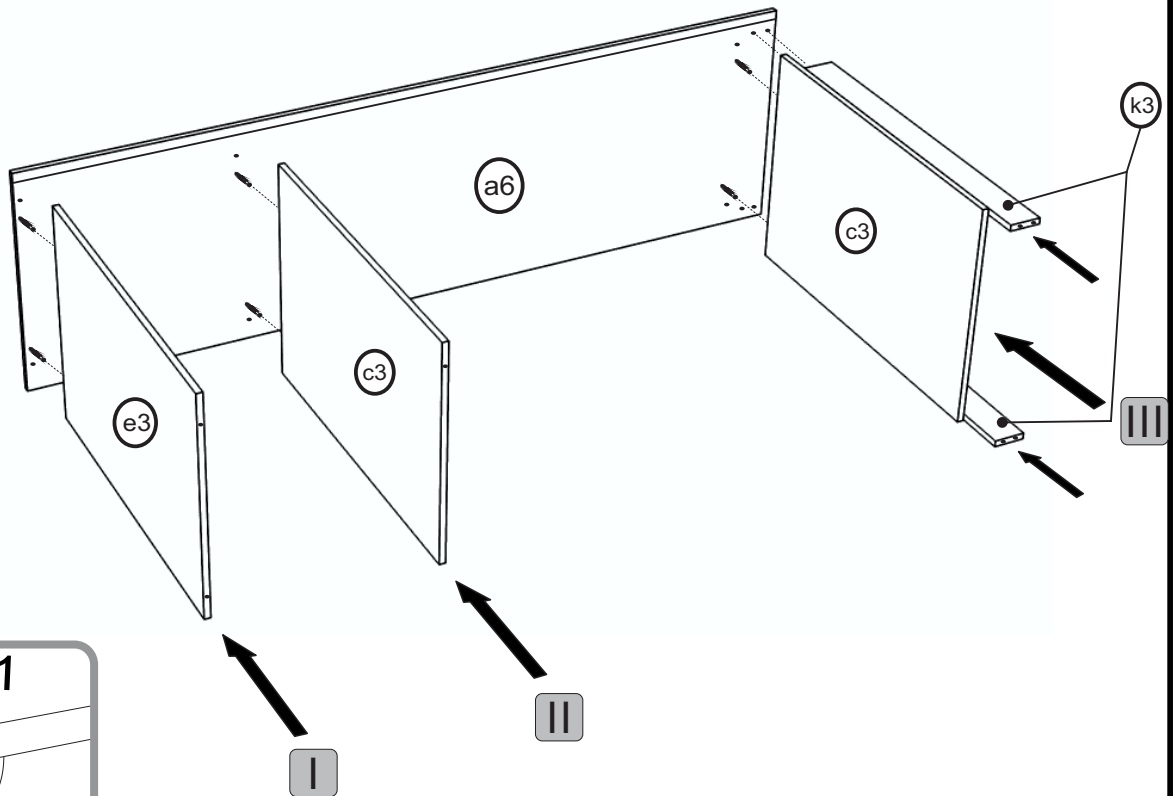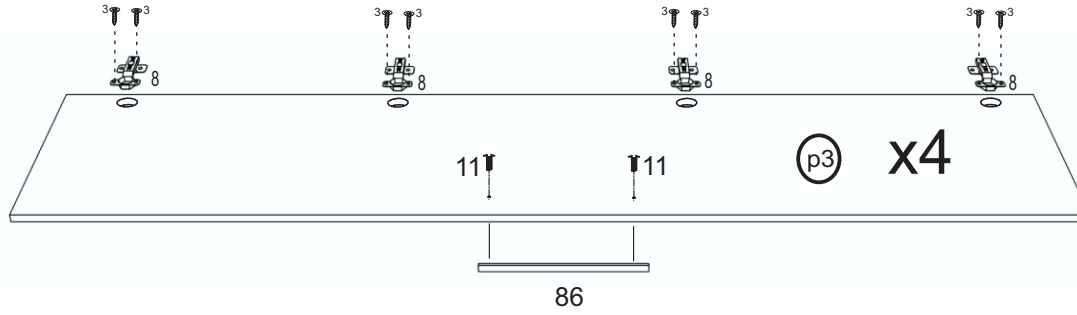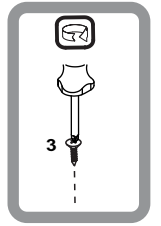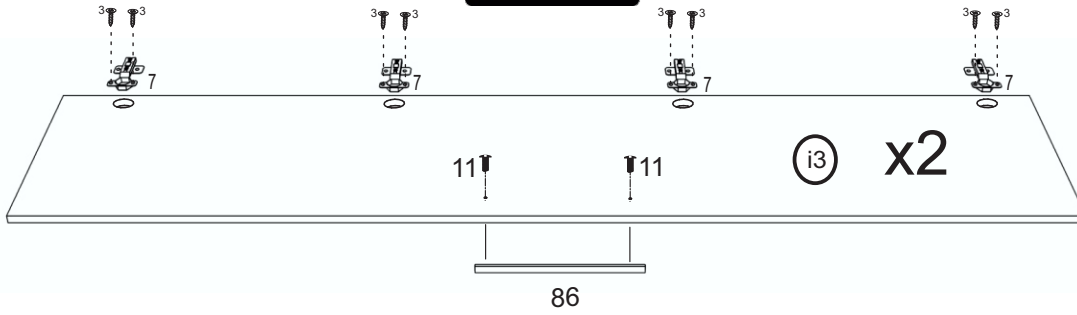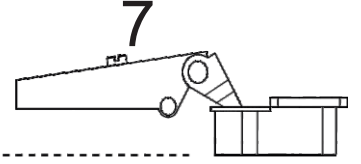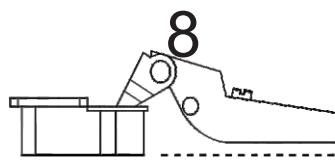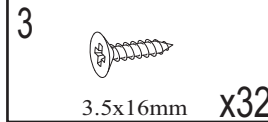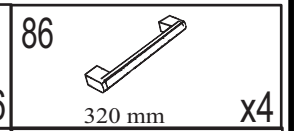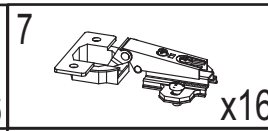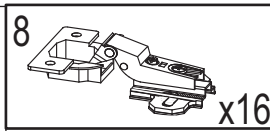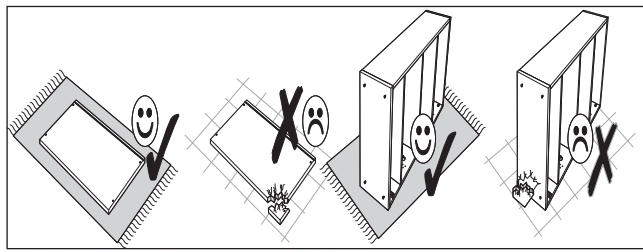






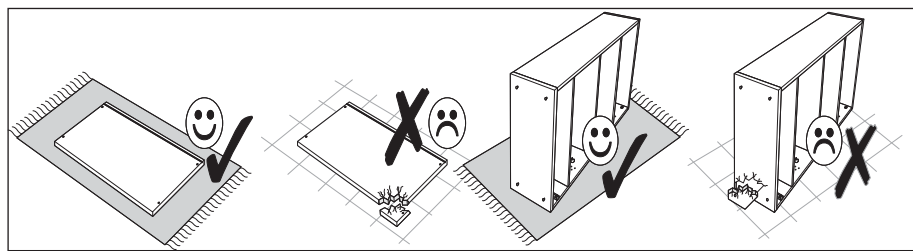






49 
 $\phi 7 \times 68$ mm x6

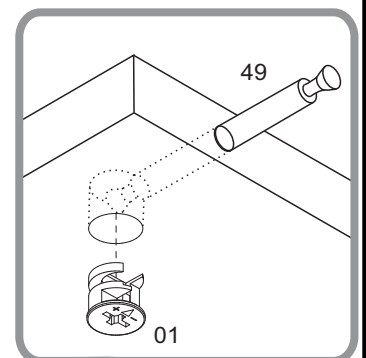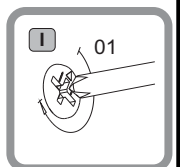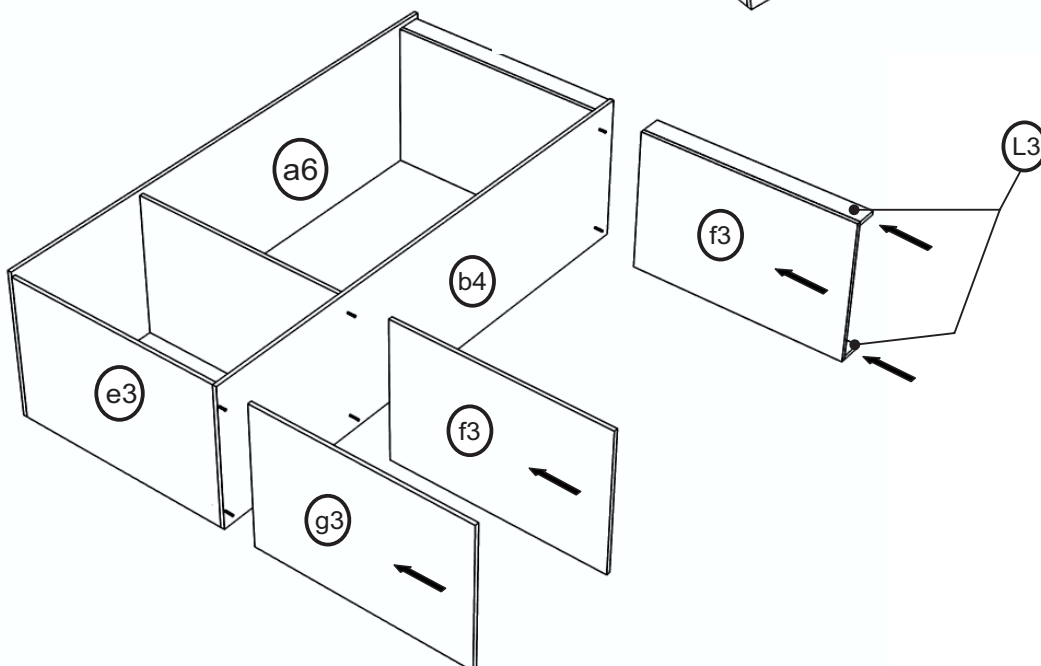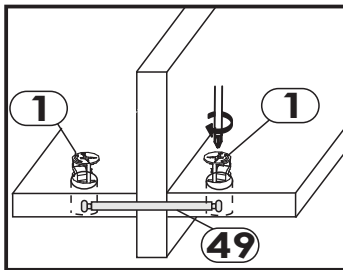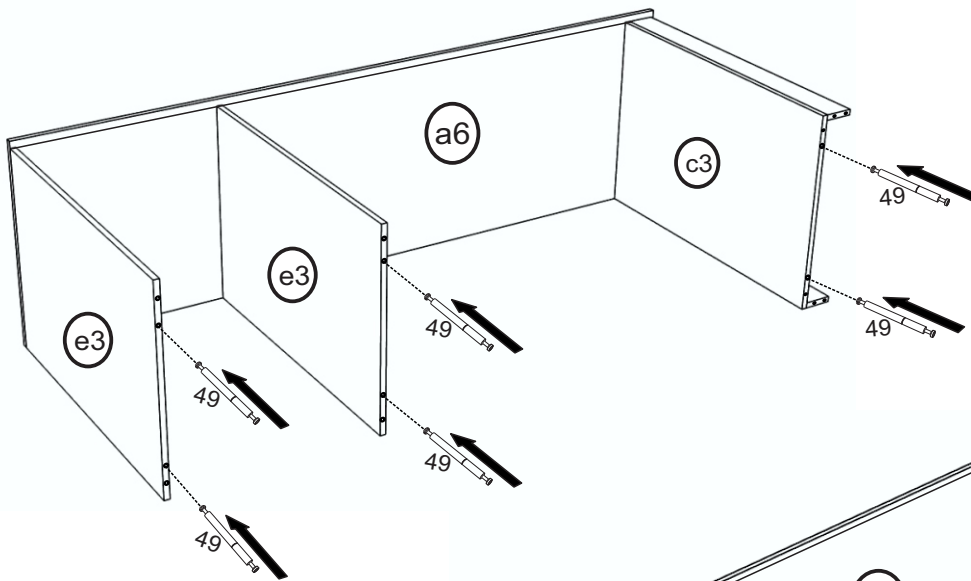


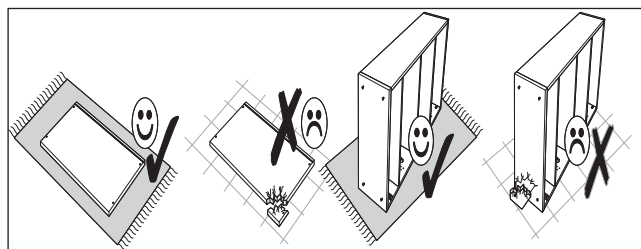

49 
 $\phi 7 \times 68$ mm x6

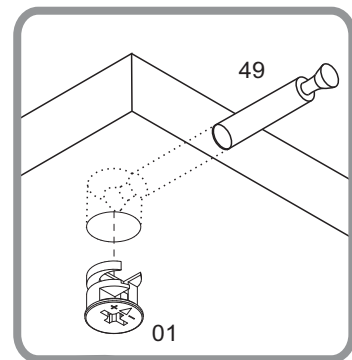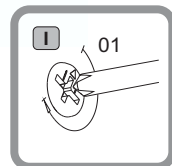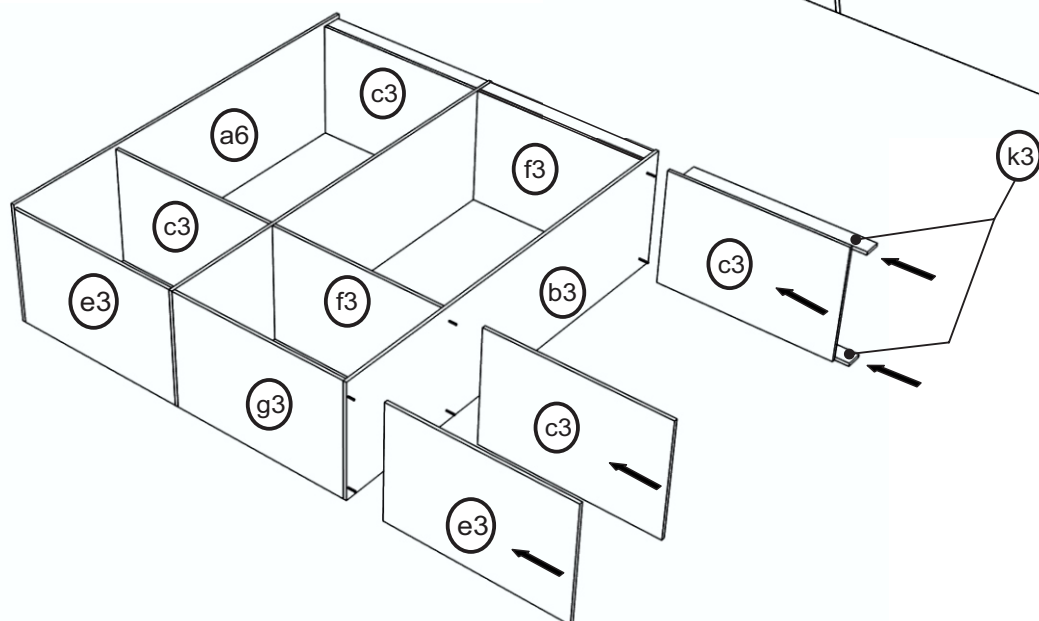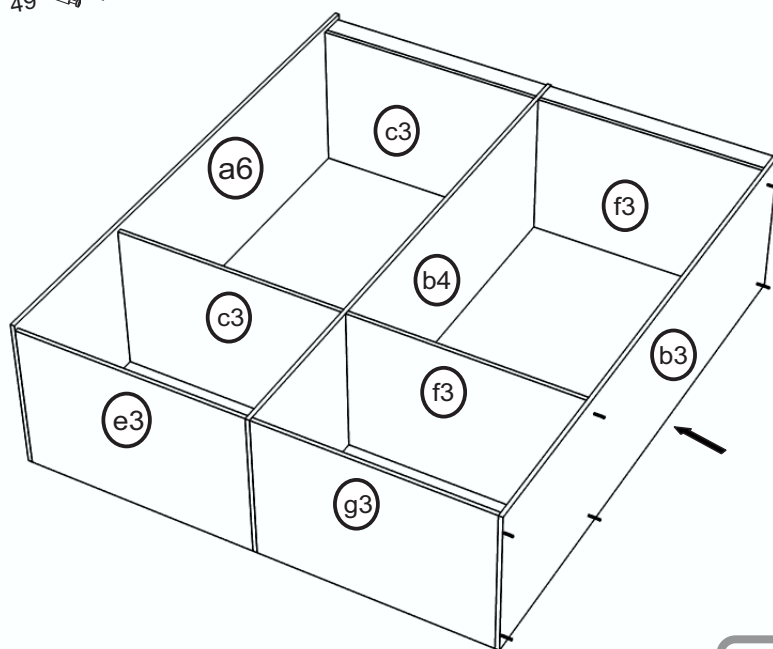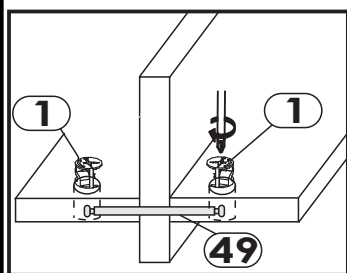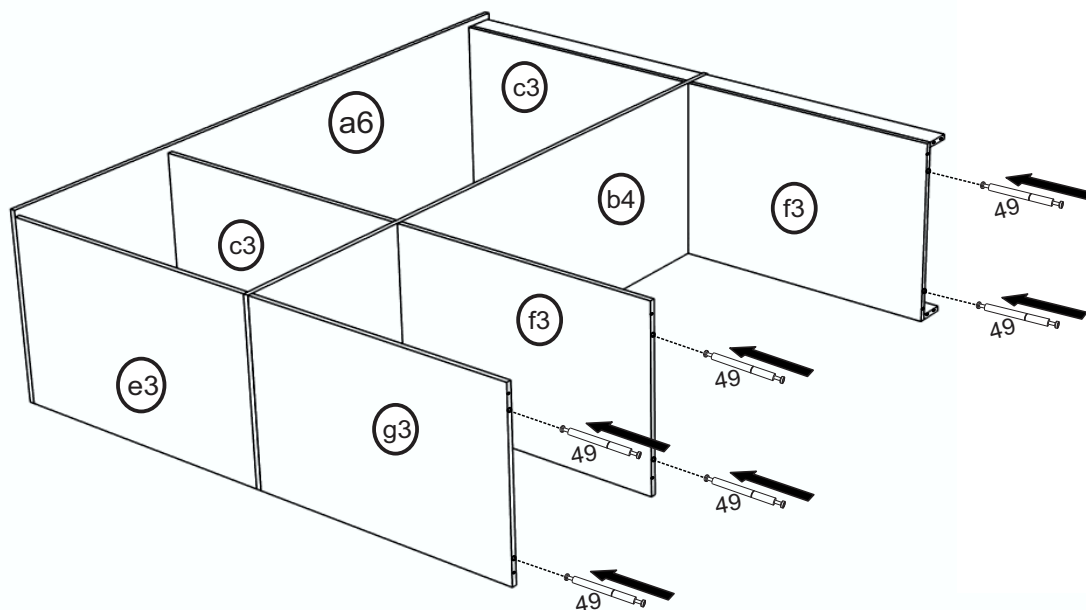


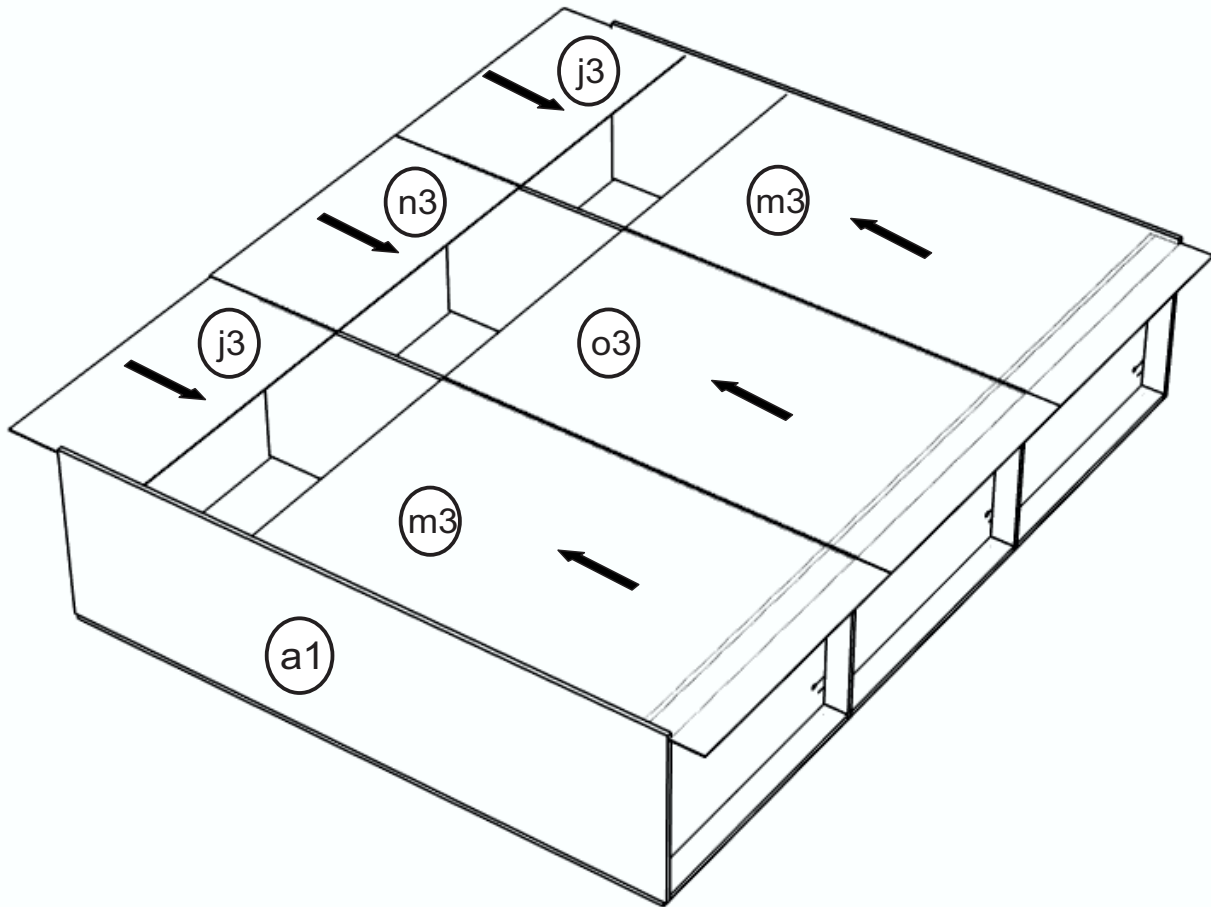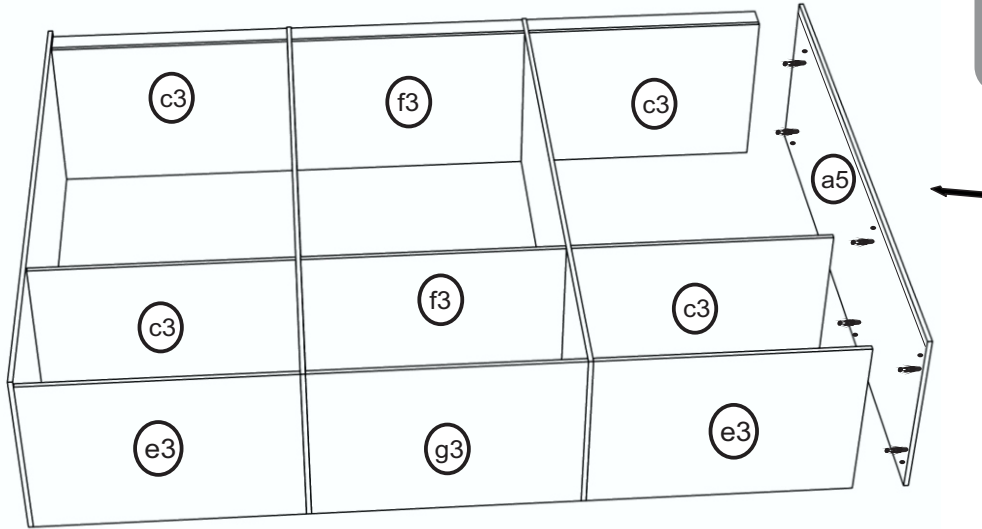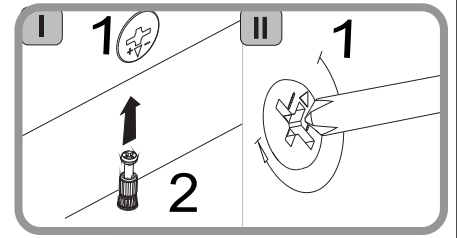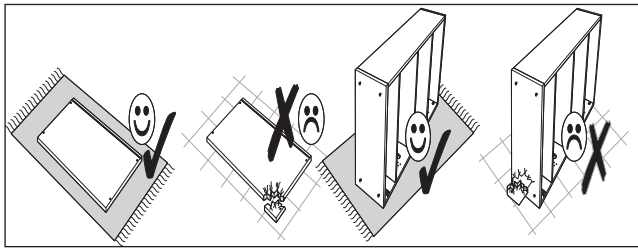

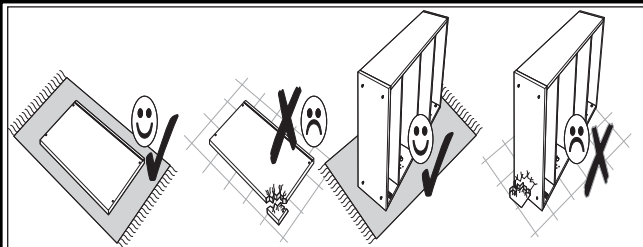

58


x39

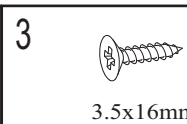

3

3.5x16mm

x66



25

x8



69

9x20x100mm



x14








39


3.5x25mm

x39

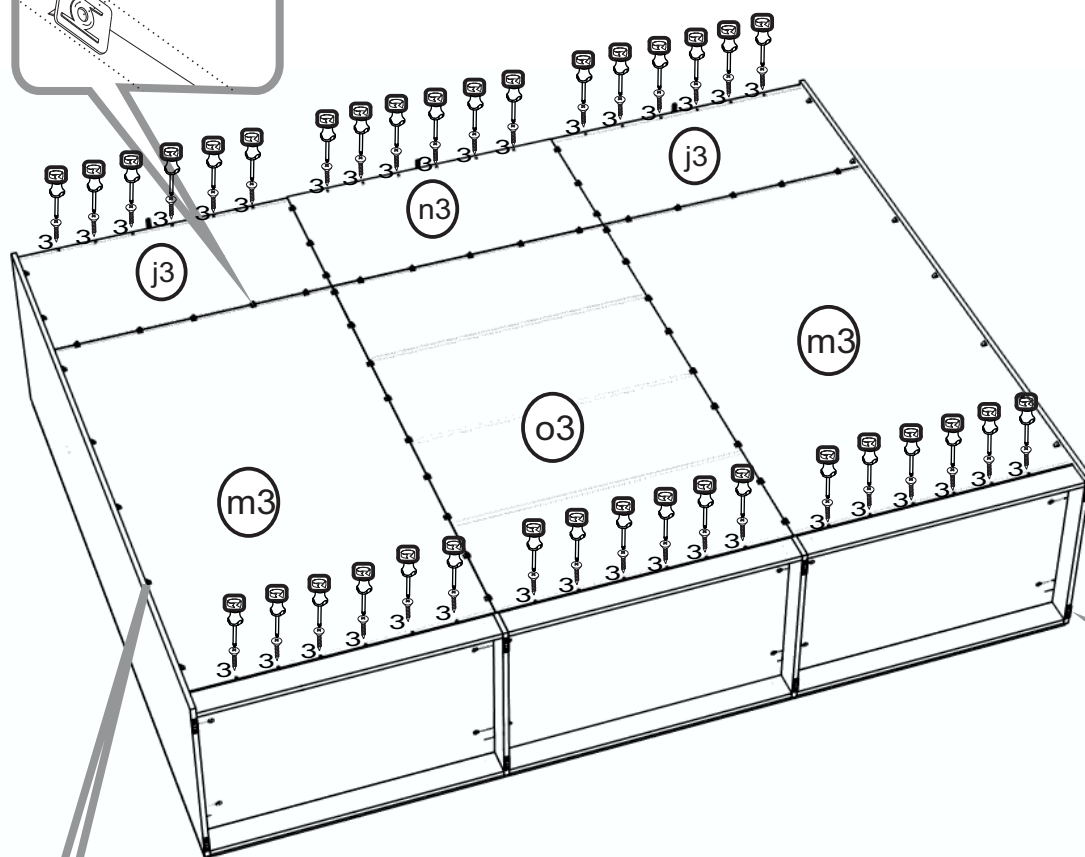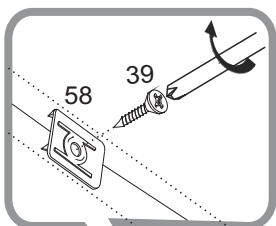

A=B

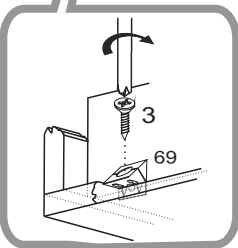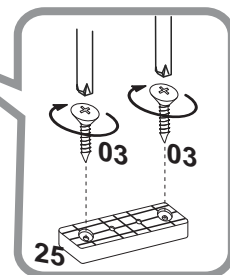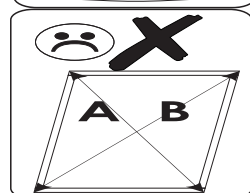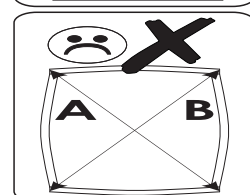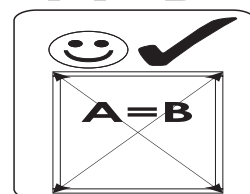

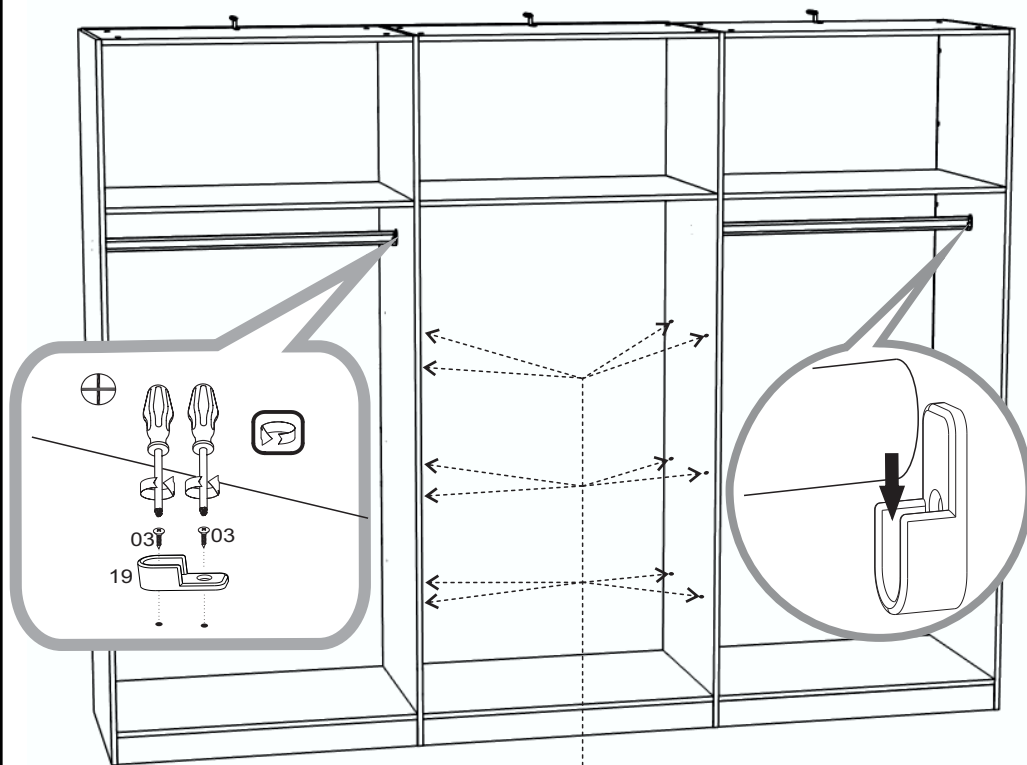

73

73		15x15x7mm	x12
10		Ø 6.3x11mm	x32
19		45x21x7mm	2x
3		3.5x16mm	x4
46		Ø15mm	x12

